

1108-XX, 1208-XX, 1308-XX & 1408-XX Deck Mount Tub Filler Installation Instructions

CALIFORNIA FAUCETS RECOMMENDS THAT ALL PLUMBING PRODUCTS BE INSTALLED BY A LICENSED PROFESSIONAL

IMPORTANT: Read all instructions prior to installation and provide copy of instructions to consumer.

Operating Specifications: Recommended Supply Pressure:

20 to 70 psi *†

Maximum Flow Rate:

15 gpm

* Operating pressures between hot and cold supplies should vary no more than 30 psi.

† If water pressure exceeds 70 psi, install a Pressure-Reducing Valve (RPV).


PREPARING & ATTACHING LEGS

Important: It is the responsibility of the **INSTALLER** to discuss with **CONSUMER** as to which side the HANDSHOWER **(21)** shall be placed on the Floor Mounted Tub Filler before proceeding.

- LEG (1) <u>without handshower</u> place SPACER (4) at top of LEG (1)
- LEG (1) <u>with handshower</u> place friction WASHER
 (2), then HOOK (3) and second friction WASHER
 (2) on top of LEG (1) (HOOK shall have one friction WASHER on top and bottom)


Important: Proper orientation of the HOOK **(3)** is necessary to properly allow HANDSHOWER **(11)** to fit into HOOK **(3)** before proceeding.

 Attach CONICAL (10a) nut of HOSE (10) to HANDSHOWER (11) to confirm proper orientation of the HOOK (3) as shown below

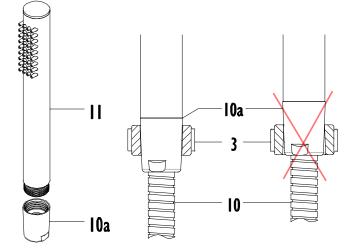


Important: The LEGS (I) have <u>left-handed threads</u>, therefore, it is necessary to rotate LEGS (I) <u>counter-clockwise</u> into BODY (5)

- Using thread SEALER (1b) securely tighten SHANK (1a) into LEG (1); repeat on other side
- Ensure that there is sufficient grease on both upper O-rings on LEG (1) and securely tighten into BODY (5); repeat same procedure on other side

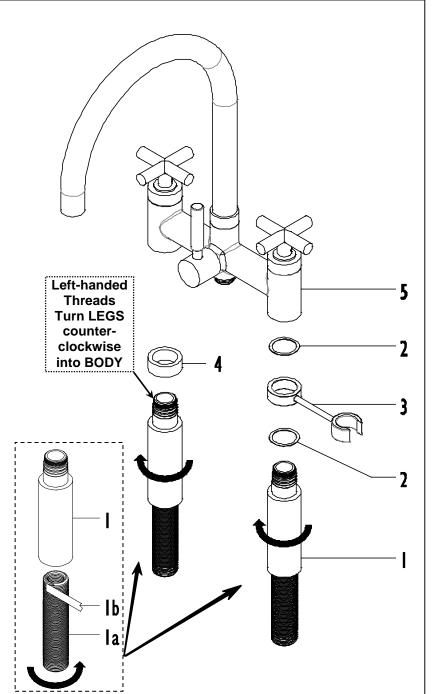

2 SECURING LEGS TO DECK

- Place O-RING (6) into bottom side FLANGE (7)
- Slide leg SHANK (1a) through FLANGE (7) and deck surface
- Securely tighten NUT (8) onto leg SHANK (1a)
- Repeat same procedure on other side

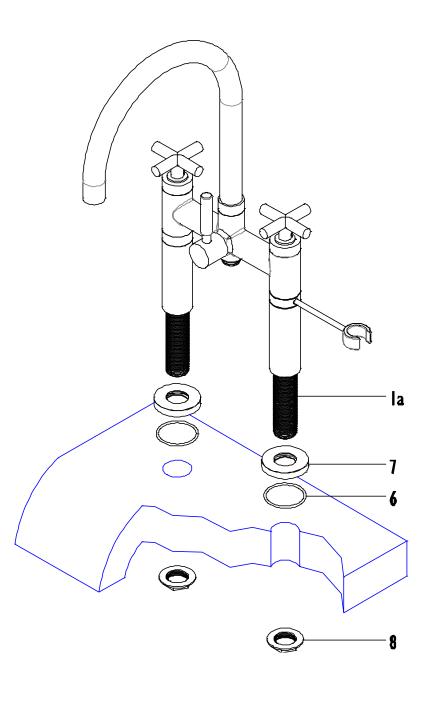

CONNECTING WATER SUPPLY

Warning: When soldering or use of FLAME on leg SHANK (1a), it is the responsibility of the installer to take proper steps to prevent over heating of the leg SHANK (1a) to prevent damage to sealed joint between LEG (1) and leg SHANK (1a). All soldering shall be a minimum of 4" away from joint

- Use one of the following methods to supply water to leg SHANKS (1a):
 - ¾" Female ADAPTER (9a) Requires use of Thread Sealant on male threads of leg SHANK (1a)
 - ³/₄" SWEAT (9b) copper tube
- Repeat same procedure on other side

WARNING: Do NOT apply excess heat when soldering copper tubes as this may cause leaks at joints indicated

la

9a

HOT

supply

9b

COLD supply

4 FINAL CONNECTIONS

- Attach inlet of CHECK VALVE (12) to lower OUTLET (5a) of BODY (5)
- Attach HEX (10b) nut of HOSE (10) to lower outlet of CHECK VALVE (12)
- Operate faucet divert from tub spout to handshower and check for leaks

