

CAUTION – RISK OF SHOCK –

Disconnect Power at the main circuit breaker panel or main fuse box before starting and during the installation.


INSTRUCTIONS

For Assembling and Installing Fixtures in Canada
Pour L'assemblage et L'installation Au Canada

- 1) Thread hexnut onto threaded pipe so that 5 threads are exposed below hexnut. From underside of mounting strap, thread long end of threaded pipe into hole in mounting strap until hexnut touches mounting strap. Tighten hexnut against mounting strap.
- 2) Thread second hexnut onto other end of threaded pipe. Tighten hexnut up against mounting strap.
- 3) Attach mounting strap to outlet box.
- 4) Make wire connections. Reference chart below for correct connections and wire accordingly.

Connect Black or Red Supply Wire to:	Connect White Supply Wire to:
Black	White
*Parallel cord (round & smooth)	*Parallel cord (square & ridged)
Clear, Brown, Gold or Black without tracer	Clear, Brown, Gold or Black with tracer
Insulated wire (other than green) with copper conductor	Insulated wire (other than green) with silver conductor

*Note: When parallel wires (SPT I & SPT II) are used. The neutral wire is square shaped or ridged and the other wire will be round in shape or smooth (see illus.)

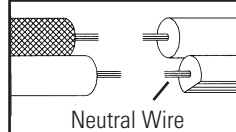

- 5) Push fixture to wall, carefully pass threaded pipe through hole in canopy of fixture. Care should be taken to insure that wires are completely inside canopy.
- 6) Screw threaded cap onto threaded pipe. Tighten threaded cap to secure fixture to wall.
- 7) Insert recommended bulb (Not supplied)
- 8) Lower glass down over socket. Carefully slide glass over the spring clips and rest onto fixture base.
- 9) Set roof down on top of fixture. Align the holes in the roof with the holes in the fixture.
- 10) Thread screws up through holes in fixture and into roof. Tighten screws to secure roof in place.

**INSTRUCTIONS FOR MOUNTING
FIXTURE OUTDOORS AND/OR IN WET LOCATIONS**

- 11) Mounting surface should be clean, dry, flat and 1/4" larger than the canopy on all sides. Any gaps between the mounting surface and canopy exceeding 3/16" should be corrected as required.
- 12) With silicone caulking compound, caulk completely around where back of canopy meets the wall surface to prevent water from seeping into outlet box.

INSTRUCTIONS

For Assembling and Installing Fixtures in Canada
Pour L'assemblage et L'installation Au Canada

